Data sheet article Q-46-30-10-N

Technical data and application safety

Webcraft GmbH
Industriepark 206
78244 Gottmadingen, Germany

Phone: +49 7731 939 839 1

www.supermagnete.de
support@supermagnete.de

1. Technical information

Neodymium supermagnet - Block magnet 46 x 30 x 10 mm, holds approx. 29 kg

Article ID	Q-46-30-10-N
EAN	7640155436526
Material	NdFeB
Shape	Block
Size	46 x 30 x 10 mm
Side 1	46 mm
Side 2	30 mm
Side 3	10 mm
Pole faces	46 x 30 mm
Tolerance	+/- 0,1 mm
Magnetisation axis	10 mm
Coating	Nickel-plated (Ni-Cu-Ni)
Manufacturing method	sintered
Magnetisation	N40
Strength	approx. 29 kg (approx. 284 N)
Displacement force	approx. 5,8 kg (approx. 56,9 N)
Max. working temperature	80°C (possibly lower) *
Colour	Silver-coloured
Direction of magnetisation	Magnetised heightwise
Weight	104,8800 g
Curie temperature	310 °C
Residual magnetism Br	12600-12900 G, 1.26-1.29 T
Coercive field strength bHc	10.5-12.0 kOe, 860-955 kA/m
Coercive field strength iHc	≥12 kOe, ≥955 kA/m
Energy product (BxH)max	38-40 MGOe, 303-318 kJ/m³

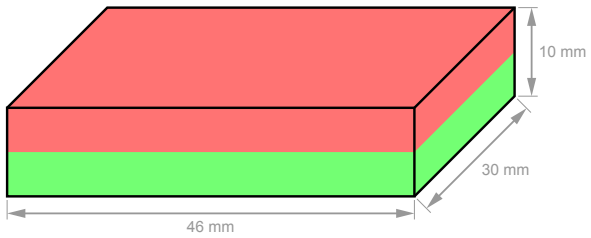

* Based on the dimensions it is possible that this magnet has a reduced temperature resistance. Please review our FAQ: https://www.supermagnete.de/eng/faq/What-temperatures-can-magnets-withstand#pu424

Product compliant with the latest European RoHS directive.

Product compliant with the latest European REACH regulation.

2. Safety tips

Warning	Contusions
	Big magnets have a very strong attractive force. • Unsafe handling could cause jamming of fingers or skin in between magnets. This may lead to contusions and bruises. • Powerful, very large magnets could cause bone fractures. Wear heavy protective gloves when handling larger magnets.

Warning

Pacemaker

Magnets could affect the functioning of pacemakers and implanted heart defibrillators.
- A pacemaker could switch into test mode and cause illness.
- A heart defibrillator may stop working.

- If you wear these devices keep sufficient distance to magnets: www.supermagnete.de/eng/faq/distance
- Warn others who wear these devices from getting too close to magnets.

Warning

Heavy objects

Too heavy loads, symptoms of fatigue as well as material defect could cause a magnet or magnetic hook to loosen from the surface that is was attached to.
Falling objects could lead to serious injuries.

- The indicated adhesive force applies only to ideal conditions. Allow for a high safety cushion.
- Don't use magnets in places where people could sustain injuries in case of material failure.

Warning

Metal splinters

Neodymium magnets are brittle. Colliding magnets could crack.
Sharp splinters could be catapulted away for several meters and injure your eyes.

- Avoid the collision of magnets.
- Wear safety glasses when handling larger magnets.
- Make sure that nearby people are also protected or keep their distance.

3. Handling and storing

Caution

Magnetic field

Magnets produce a far-reaching, strong magnetic field. They could damage TVs and laptops, computer hard drives, credit and ATM cards, data storage media, mechanical watches, hearing aids and speakers.

- Keep magnets away from devices and objects that could be damaged by strong magnetic fields.
- Please refer to our table of recommended distances: www.supermagnete.de/eng/faq/distance

Caution

Combustibility

When machining Neodymium magnets, the drilling dust could easily ignite.

Stay away from machining magnets or use appropriate tools and sufficient cooling water.

Caution

Nickel allergy

Many of our magnets contain nickel, also those without nickel coating.
- Some people have an allergic reaction when they come into contact with nickel.
- Nickel allergies could develop from perpetual contact with nickel-plated objects.

- Avoid perpetual skin contact with magnets.
- Avoid contact with magnets if you already have a nickel allergy.

Notice

Influence on people

According to the current level of knowledge, magnetic fields of permanent magnets do not have a measurable positive or negative influence on people. It is unlikely that permanent magnets constitute a health risk, but it cannot be ruled out entirely.

- For your own safety, avoid constant contact with magnets.
- Store large magnets at least one metre away from your body.

Notice	**Splintering of coating**
	Most of our neodymium magnets have a thin nickel-copper-nickel coating to protect them from erosion. This coating could splinter or crack due to collision or large pressure. This makes them vulnerable to environmental influences like moisture and they could oxidise. • Separate big magnets, especially spheres, with a piece of cardboard. • Avoid collisions of magnets as well as repeated mechanical exposure (e.g. blows, bashes).

Notice	**Oxidation, corrosion, rust**
	Untreated neodymium magnets oxidise quickly and disintegrate. Most of our magnets have a nickel-copper-nickel coating to protect them from corrosion. This coating provides some protection against corrosion, but it is not robust enough for continuous outdoor use. • Use magnets only in the dry indoors or protect them against environmental influences. • Avoid damages to the coating.

Notice	**Temperature resistance**
	Depending on the magnet type, neodymium magnets have a maximum working temperature of 80 to 200 °C. Very thin neodymium magnets and magnets with N52 magnetisation have a maximum working temperature of 65 °C. Most neodymium magnets lose part of their adhesive force permanently at a temperature of 80°C. • Don't use magnets in places where they are exposed to extreme heat. • If you use an adhesive, don't harden it with hot air. • Please note our overview of temperature resistance: www.supermagnete.de/eng/faq/temperature

Notice	**Mechanical treatment**
	Neodymium magnets are brittle, heat-sensitive and oxidise easily. • When drilling or sawing a magnet with improper tools, the magnet may break. • The emerging heat may demagnetise the magnet. • The magnet will oxidise and disintegrate due to the damaged coating. Avoid machining magnets if you do not have the necessary machines and experience. Let us provide you with an offer for a custom-made order instead: www.supermagnete.de/eng/quotation/custom/request

4. Transportation tips

Caution	**Airfreight**
	Magnetic fields of improperly packaged magnets could influence airplane navigation devices. In the worst case it could lead to an accident. • Airfreight magnets only in packaging with sufficient magnetic shielding. • Please refer to the respective regulations: www.supermagnete.de/eng/faq/airfreight

Caution	**Postage**
	Magnetic fields of improperly packaged magnets could cause disturbances in sorting machines and damage fragile goods in other packages. • Please refer to our shipping tips: www.supermagnete.de/eng/faq/shipping • Use a large box and place the magnet in the middle surrounded by lots of padding material. • Arrange magnets in a package in a way that the magnetic fields neutralise each other. • If necessary, use sheet iron to shield the magnetic field. • There are stricter rules for airfreight: Refer to the warning notice "Airfreight".

5. Disposal tips

Small amounts of used neodymium magnets can be thrown out with the regular trash. Larger amounts of magnets need to be recycled as scrap metal.

6. Statutory provisions

Please note that the export of neodymium magnets to the US, Canada and Japan may be subject to patent restrictions. We recommend that you clarify the legal aspects before exporting to these countries.

TARIC-Code: 8505 1110 30 0

Origin: China

For more information about magnets please review
https://www.supermagnete.de/eng/faqs.

Last update: 15/10/2026